

Dromex




CUT 5 CAMO GLOVES
52J



52J

EN 388: 2003



4542

EN 407:2004



X1XXXX

Compliance & Conformity

Complies with the requirements of CE type examinations EN 420 for innocuousness, EN 388, Mechanical Risks (4,5,4,2) and EN 407:2004 Thermal Risks for Heat and Flame (X,1,X,X,X,X) for compliance with directive 89/686/EEC, Quality System conforms to ISO 9001:2008.

Specifications

Style: Wing thumb, dipped palm and fingers
Liner: NIL
Palm: PU coated on 100% Dromex® Cut5 fibre 0.03 mm ± 5 %
Back: 100% Dromex® Cut5 0,02mm ± 5 %
Cuff: Dromex® Cut5
Mass: ±73g per glove (size 11)

Sizes Available

8-11

Packaging, Storage & Obsolescence


Packed in individual polybags and sold as 12 pairs per carton for shipping. Store in a cool, dry place. Stored correctly, the gloves physical properties will not change for up to three years.



Cleaning & Maintenance

Gloves should not be left in a contaminated condition if re-use is intended especially if potential hazards exist. Before removal from the hands excess contaminant should first be removed from the gloves. Should this not be possible, it is advisable to ease left and right hand gloves off using the gloved hand and remove the gloves without the contaminant contacting the bare hands.

The gloves may then be decontaminated as indicated below:



100% Dromex® Cut5 gloves have proven that dry cleaning as well as laundering are suitable cleaning methods.

We recommend that no bleaching or oxidising ingredients or any fabric softeners be used.

Recommended washing temperature is between 40°C and 60°C (104~140°F) with mild detergents.

The drying process may cause felting on the fabric surface.

Drying temperature should not exceed 70°C (158°F).

There is no remarkable impact on cut resistance during the normal life-cycle of a glove however, depending on glove construction, staining and cleaning method, the differences in shrinkage, yarn strength and colour may occur.

In order to maximise the glove life cycle, we recommend the mildest possible cleaning conditions in terms of temperature, chemicals and cycle duration.

Disposal


All industrial waste should be disposed of correctly according to local regulations and good disposal practice. Gloves should be disposed of considering the hazardous substances they were used for. Please consider recycling.

Materials



1. Wing thumb
2. Dipped palm & fingers
3. Dromex® Cut5 cuff

Marking

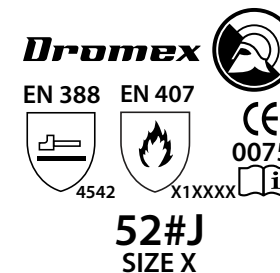

Description

Dromex® 52J 100% CUT5 fibre gloves, with PU coating on the palms, provides protection against cuts, abrasion and contact heat resistance at 100°C for 15 seconds.

Camouflaged patterned, with PU coating provides excellent dexterity, makes this glove is the ideal choice in military, police force, outdoor hunting, mining and industrial applications.

Special Instructions

Although the manufacturer has examined these gloves under the system for ensuring quality of production by means of monitoring and inspection, we recommend that all gloves should be thoroughly inspected before use to ensure no damage is present.

None of the materials or processes used in the manufacture of these products are known to be harmful to the wearer. The gloves and information contained herein are designed to accommodate the basic safety requirements and standards for Personal Protective Equipment. Actual conditions of use cannot be directly simulated in a test environment, therefore it is the responsibility of the user and not the manufacturer or supplier to determine the suitability for intended use.